



深圳市诚锦鹏实业有限公司
SHENZHEN CHENGJINPENG INDUSTRIAL CO., LTD

无损检测报告

NONDESTRUCTIVE TESTING REPORT

工程名称 Project Name: LH29-1 12 寸收发球筒维修测试

LH29-1 12inch PLRs Refurbishment

委托单位 Commission Unit : 青岛太平洋海洋工程（深圳）有限公司

委托单位地址 Client Address: 宝安区松岗街道罗田社区龙山二路 1 号

工程编号 Project No. : CJP-WR-051-344-19-014

检测方法 Inspection Method : UTT

报告编号 Report No. : CJP-WR-051-344-UTT001-19-014

页数 Number of pages : 5

报告日期 Report Date : 2019.03.20

批准人 Approved by : [Signature]



检测单位: 深圳市诚锦鹏实业有限公司

CONTRACTOR: SHENZHEN CHENGJINPENG INDUSTRIAL CO.,LTD

地 址: 深圳市南山区月亮湾大道 2076 号高科大厦 6FC3

ADDRESS: C3F6, GAOKE BUILDING, NO.2076, YUELIANGWAN BLVD, NANSHAN DISTRICT, SHENZHEN

电 话 Tel: 0755-86274981/26440278

URL: <http://www.cipsz.com> E-mail: cipsz126@126.com



深圳市诚锦鹏实业有限公司
SHENZHEN CHENGJINPENG INDUSTRIAL CO.,LTD

超声波测厚报告
ULTRASONIC THICKNESS MEASUREMENT REPORT

项目名称: LH29-1 12寸收发球筒维修测试

报告日期

报告编号

Project Name: LH29-1 12inch PLRs Refurbishment

Report Date: 2019.03.20

Report No.: CJP-WR-051-344-UTT001-19-014

结构名称 Structure Name		PIG LAUNCHER/PIG RECEIVER		参考标准 Reference Criteria		GB/T11344-2008		对比试块 Reference Block		阶梯试块 Step Block			
检测地点 Testing Position		太平洋车间 QPOC Workshop		仪器型号 Instrument Type		CYGNUS1		表面温度 Surface Temperature		20℃			
检测比例 Testing Rate		抽检 Sampling Inspection		制造编号 Manufacture No.		CJP-CH-12		表面状态 Surface Condition		油漆 Oil Paint			
工件材质 Workpiece Material		S355		声速设定 Sound Velocity Settings		5965m/s		耦合剂 Couplant		化学浆糊 Chemical Paste			
测量点 Item	构件规格 (mm) Member Spec.	标称厚度 (mm) Nominal Thickness	横向T 纵向L	实测值 (mm) Measurement Thickness							最小值 Minimum Thickness	最大衰减量 % Max Attenuation	备注 Remark
				A	B	C	D	E	F	G			
PIG LAUNCHER P1	--	--	--	24.30	24.40	24.15	24.55	--	--	--	24.15	--	--
PIG LAUNCHER P2	--	--	--	19.25	18.80	17.65	18.60	--	--	--	17.65	--	--
PIG LAUNCHER P3	--	--	--	21.15	22.95	21.90	19.85	--	--	--	19.85	--	--
PIG LAUNCHER P4	--	--	--	20.30	22.40	22.05	20.05	--	--	--	20.05	--	--
PIG LAUNCHER P5	--	--	--	20.50	21.70	20.85	19.40	--	--	--	19.40	--	--
PIG LAUNCHER P6	--	--	--	19.35	19.10	19.10	19.35	--	--	--	19.10	--	--
PIG LAUNCHER P7	--	--	--	19.25	19.15	19.35	19.30	--	--	--	19.15	--	--
PIG LAUNCHER P8	--	--	--	19.80	18.90	19.25	18.80	--	--	--	18.80	--	--
PIG LAUNCHER P9	--	--	--	13.80	12.95	13.80	14.25	--	--	--	12.95	--	--
PIG LAUNCHER P10	--	--	--	13.40	13.95	13.30	13.60	--	--	--	13.30	--	--
PIG LAUNCHER P11	--	--	--	13.80	14.10	13.35	12.90	--	--	--	12.90	--	--
PIG LAUNCHER P12	--	--	--	13.20	13.85	14.25	13.70	--	--	--	13.20	--	--
PIG LAUNCHER P13	--	--	--	13.50	13.90	13.45	11.75	--	--	--	11.75	--	--
PIG RECEIVER P1	--	--	--	24.70	24.55	24.70	24.70	--	--	--	24.55	--	--
PIG RECEIVER P2	--	--	--	18.90	18.30	18.55	19.00	--	--	--	18.30	--	--
PIG RECEIVER P3	--	--	--	16.85	18.75	16.60	15.60	--	--	--	15.60	--	--
PIG RECEIVER P4	--	--	--	16.75	18.60	16.45	15.85	--	--	--	15.85	--	--
PIG RECEIVER P5	--	--	--	16.50	18.60	16.75	15.80	--	--	--	15.80	--	--
PIG RECEIVER P6	--	--	--	18.40	18.20	18.60	18.50	--	--	--	18.20	--	--
签字 Signature		检验员 (Inspector) Li le				技术监督 (Tech. Supervisor) Tang Yue zu				签字授权人 (Authorized Signee) Tang Yue zu			
日期 Date		2019.03.20				2019.03.20				2019.03.20			



超声波测厚报告

ULTRASONIC THICKNESS MEASUREMENT REPORT

报告编号:

Report No. :CJP-WR-051-344-UTT001-19-014

Form No. :CJP/WR. UTT02 Rev:E/0

检测报告附图 SKETCH OF DETECTION POSITION


报告编号:

Report No: CJP-WR-051-344-UTT001-19-014

6.0 Wall thickness checks


Perform Wall thickness checks at 12, 3, 6 & 9 o'clock positions at following locations:

在 12、3、6 和 9 点钟位置进行壁厚检查在下面位置:

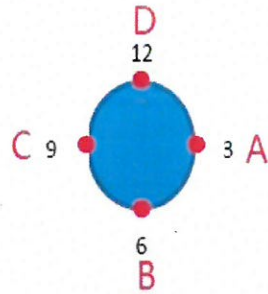

PIG LAUNCHER P1-P13

PIG RECEIVER P1-P13

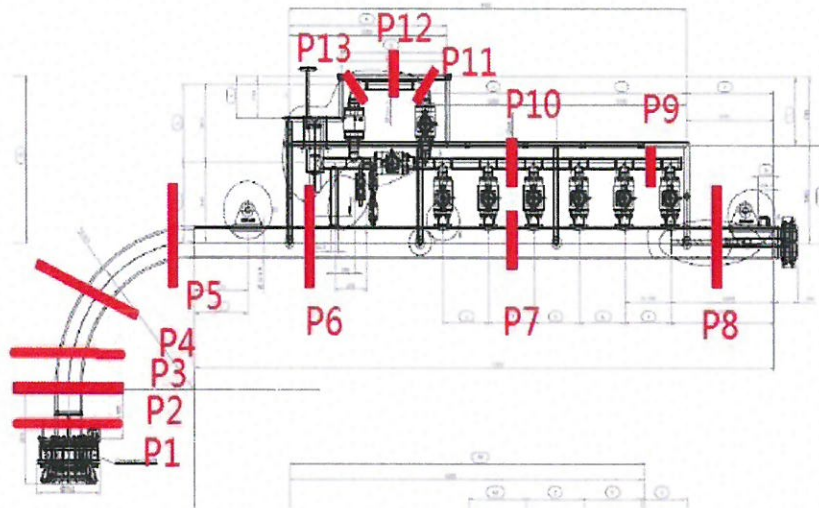

PIG LAUNCHER / PIG RECEIVER



备注

Remark

1. 报告无检测单位“检测专用章”无效。

Report without the specified inspection stamp of CJP company is invalid.

2. 报告无操作人员或评片人、技术监督、技术负责人签字无效。

Report without the signatures of operator of film judge, tech. supervisor and tech. principal is invalid.

3. 本报告涂改无效。

Report with alteration will be invalid.

4. 本报告仅对被检产品受检部位负责。

Report is only responsible for the inspective pieces.

5. 未经检测单位同意不得复制本报告。

Report should not be copied without the agreement of CJP company.

6. 委托单位对检测结果若有异议，请于十五日内提出。

Client should inform CJP company within 15 days if there're any question about the inspective result.

7. 本报告一式三份；本公司存档一份，客户两份。

Report is in triplicity, original stored in CJP company, two copies for client.

8. 未加盖 CMA 章的检测报告，不具备向社会起证明作用的数据和结果。

The data and result of the inspection report that unsealed can not be proved to society.

检测单位：深圳市诚锦鹏实业有限公司

Contractor: Shenzhen Chengjinpeng Industrial Co.,LTD

地址：深圳市南山区月亮湾大道 2076 号高科大厦 6 层 C3

Address: Room C3, 6/F Gaoke Building, No.2076, Yueliangwan BLVD,
Nanshan District, Shenzhen.

电话/TEL: 0755-86274981/26440278

URL: <http://www.cjpsz.com> E-mail: cjpsz126@126.com